





Range Rover P38 Consol Bulb Replacement

BRITPART

The quality parts for Land Rovers

FITTING INSTRUCTIONS

Part Number - JFC102550B

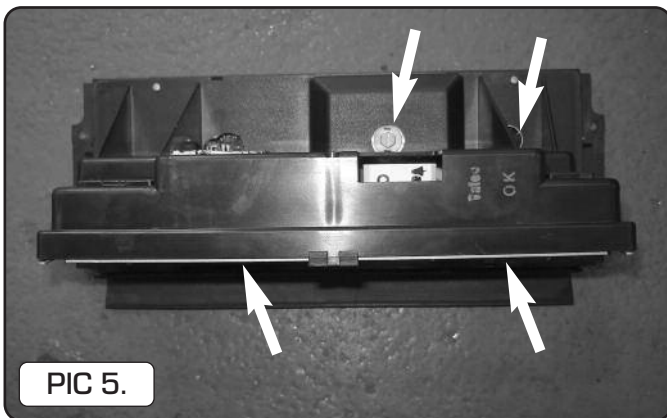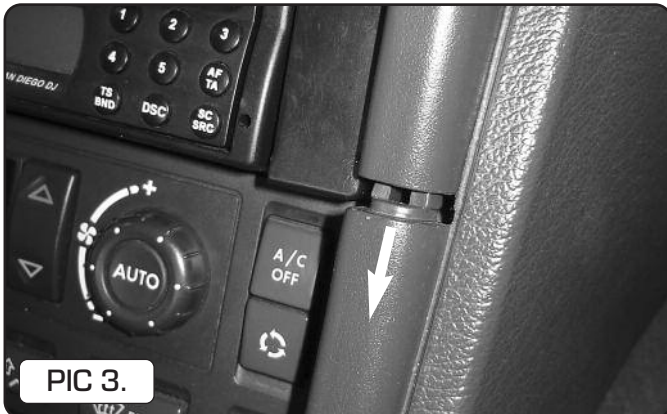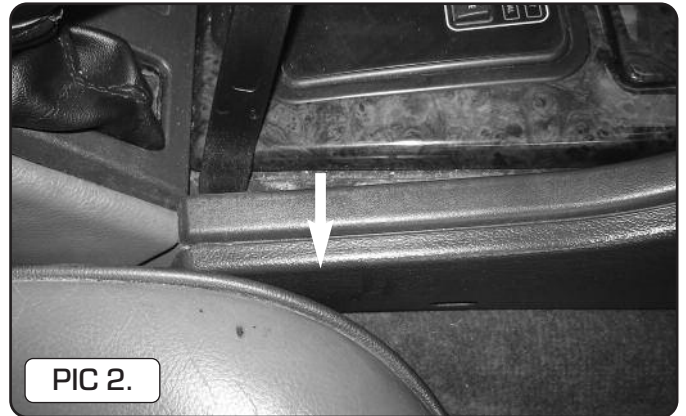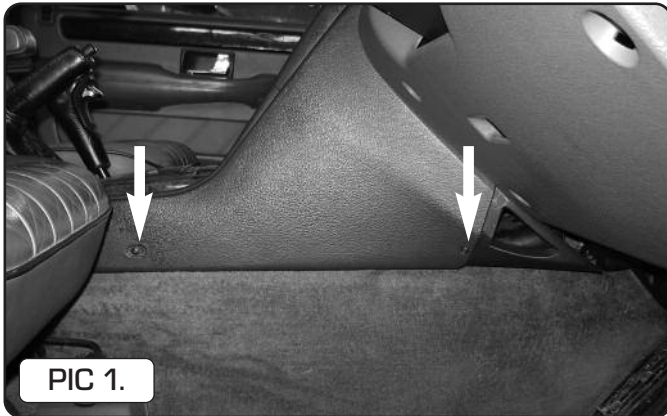

1. Before starting, push both front seats right back to access fixing screws.
2. Remove the two screws indicated (pic 1).
3. Using a trim tool (pic 2) pry the rear of the side panel up and sideways from the centre console, once you have done this push down on the front of the side panel (pic 3) to release the clip from the front. Remove the side panel and put it to one side. Repeat this process for the other side panel.
4. Remove the 4 screws (pic 4) holding in the control panel, slide out the panel and remove the electrical connectors.
5. Four of the bulbs to be changed are on the rear of the panel. Rotate them 90 degrees anticlockwise to release (pic 5).
6. The capless bulb is for the fan switch on the front of the control unit (pic 6). Pull the knob away from the unit to release it from the face panel and replace the bulb by pulling it straight out of its holder.
7. Refit electrical connectors to the control unit and test the bulbs before refitting the unit.
8. Refit the control unit into the dash and secure with the 4 screws. Refit the side panels by hooking in the front clip first before fitting the back part of the panel, refit the retaining screws.

Disclaimer

These fitting instructions are intended for general guidance only. No responsibility will be accepted for damage to persons, property, equipment or vehicles caused during or arising from the fitment or using of this product. Fitting this item to your vehicle may constitute a vehicle modification and therefore we strongly recommend that you check the product complies with local laws and legislation and always inform the vehicle's insurance company accordingly. Vr. 1.

